



800 Presque Isle Drive  
 Pittsburgh, Pennsylvania 15239-2799  
 Tel: 724/327-6100 • 800/359-8433  
 Fax: 724-387-3807

[www.foamglasinsulation.com](http://www.foamglasinsulation.com)

**PITWRAP® CW PLUS jacketing**  
**PRODUCT DATA SHEET**

**IMPORTANT: MATERIAL SAFETY DATA SHEETS ARE AVAILABLE AND SHOULD BE READ BEFORE USING THIS PRODUCT.**

**DESCRIPTION:**

PITWRAP® CW PLUS jacketing is a 50 mil thick self-sealing, modified bituminous membrane for protecting underground FOAMGLAS® insulation systems on chilled water and hot service pipelines. Manual pressure seals the jacketing without the use of a torch or heater. PITWRAP® CW PLUS jacketing may also be factory-applied on the insulation.

PITWRAP® CW PLUS jacketing consists of a polymer modified bituminous compound reinforced with a glass fabric and a 1 mil aluminum top film and release paper backing.

**\*TYPICAL PROPERTIES:**

Color:	Silver
Thickness, mils:	50 (1.27 mm)
Weight/ft <sup>2</sup> , lbs, (kg/m <sup>2</sup> ):	0.32 (1.56)
Width, inches, (cm):	23.5/35.5 (59.7/90.2)
Roll Length, ft, (m):	75 (22.86)
Sq.Ft/Roll, (m <sup>2</sup> )	147/222 (13.6/20.6)
Roll Weight, lbs, (kg):	47/71 (21.3/32.2)
Tensile Strength, lbs/in:	50
Application Temperature, min °F:	
Without Primer:	50 (10°C)
With Primer:	20 (-7°C)
Service Temperature Limits on the outside of insulation, °F, (°C):	-25 to 140 (-32 to 60)
Butt Strips:	
Width, inches, (cm):	4 (10.2)
Roll Length, ft, (m):	75 (22.86)
Permeability, ASTM E96,	
Perm inches:	0.002
Perms @ 50 mils:	0.04

\*Typical properties at time of printing, subject to change


**RESISTANCE:**

Water:	good
Alkalies:	good
Acids:	good
Petroleum Solvents:	poor
Fire:	Combustible

This is a guide. Since conditions vary, consult Pittsburgh Corning if in doubt about chemical resistance.

**FIELD APPLICATION:**

Insulation should be secured to the pipe with 2 pieces per section of fiberglass reinforced strapping tape overlapped at least 50%. Cut a length of jacketing to provide at least a four-inch overlap at the longitudinal seam. Slit the release paper at this overlap, taking care not to slit jacket. Strike a horizontal line along the insulation convenient for starting jacket positioning and to insure a uniform lap line. Remove release paper except at the overlap. Dirt and dust must be kept off jacketing. Place the end of the jacketing containing the release paper in alignment with the struck line. See sketches below. The first piece of jacketing should be straight. Smooth the remaining jacket into place working around the pipe cover. Once the jacketing is completely around the insulation, lift the overlap and pass the opposite end beneath the overlap. Remove the remaining release paper on the overlap and press tightly to seal the longitudinal joint.

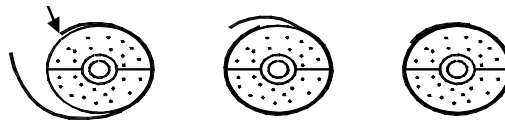

position jacketing at guide line      wrap, lift overlap, remove release paper      seal

Any gaps or folds should be removed and resealed immediately. An ordinary wallpaper seam roller has been found to be particularly useful for applying pressure to the overlap areas.

Note: Cure occurs in a few hours after seal is made

When temperature is below 50°F (10°C), or if surfaces are dirty, apply a thin coat of primer by brush to the bituminous surface in the overlap area. If temperature is below 50°F (10°C) and surfaces are clean, the overlap may be warmed with a heater or torch, taking care not to burn through the jacket.

The second and succeeding sections are applied in the same manner. Succeeding sections are placed to overlap the previous section of jacket a minimum of 2



## PITTWRAP® CW PLUS jacketing PRODUCT DATA SHEET

inches. All longitudinal joints should be started on the same line to avoid gaps.

### BUTT STRIPS:

Cut a length of butt strip at least 2.5" longer than the outer circumference of the jacketed pipe cover. Apply a bead of PITTSEAL® 444N sealant (FI-164) along the edge of the longitudinal joint the width of the butt strip. Remove the release paper from the end of the butt strip and embed the end in the sealant. Smooth the butt strip into place working down and under the cover, then up and over, finally overlapping the embedded end. Press and roll the overlap to provide a seal. After application, inspect all joints, smooth and repress any loose areas. Use primer or heat the same as for applying the jacket, if required.

### FITTINGS OR CHANGES IN THICKNESS:

With any jacketing or coating, any change in insulation thickness, such as screwed ell covers, pipe step downs, etc., should be field-tapered to make a smooth transition. These transitions should be treated as a fitting, using PITTCOTE® 300 finish mastic (FI-120) and PC® Fabric 79 (FI-159) synthetic fabric.

Fittings may be covered with jacketing cut in shapes to fit, or with PITTCOTE® 300 finish and PC® Fabric 79. When mastic is used, the mastic must be lapped over the bituminous surface and not the polyethylene surface. To do this, stop the last full section of jacket 4" (10 cm) short of the change in thickness or beginning of curvature. Apply a 4" (10 cm) butt strip with bituminous surface exposed; keeping the longitudinal lap even with the last full section. Apply a butt strip in the normal fashion over the joint between the last full section and the reversed butt strip. This leaves 2" (5 cm) of exposed bituminous surface. Apply PITTCOTE® 300 finish and PC® Fabric 79 over the fitting, lapping onto the final butt strip. In cases of severe conditions, it may be desirable to reverse a larger width than 4" (10 cm).

### LIMITATIONS:

The maximum allowable operating temperature for hot water lines when using this product is 140°F (60°C)

Do not use over combustible insulation.

Do not use in areas where jacketing will be exposed to solvents that can dissolve asphalt.  
Caution should be used in environments corrosive to the 1-mil aluminum top film

### STORAGE:

Store in a heated area for cold weather application.

### CAUTION:

**This material is intended to be used only with FOAMGLAS® insulation and in conformity with Pittsburgh Corning's standard instructions. Be sure you have read and understand all instructions and Material Safety Data Sheets before using. Material Safety Data Sheets should be considered part of this product data sheet.**

### WARNING:

**THIS PRODUCT CONTAINS A MATERIAL THAT HAS BEEN CLASSIFIED AS CARCINOGENIC TO HUMANS BY THE INTERNATIONAL AGENCY FOR RESEARCH ON CANCER (IARC) AS GROUP 1.**

### IRRITANT:

Repeated or prolonged contact may irritate skin. Wear gloves. If heated, fumes are irritants to eyes, nasal and respiratory tract.

### HARMFUL OR FATAL IF SWALLOWED.

### COMBUSTIBLE:

Store in a cool area. Keep away from open flame or ignition sources.

### FIRE HAZARD CLASSIFICATION:

Health: 1      Fire: 1      Reactivity: 0

### KEEP OUT OF REACH OF CHILDREN

This material is designed for application only for professional, trained personnel using proper equipment and is not intended for sale to the general public.

The information contained herein is accurate and reliable to the best of our knowledge. But, because Pittsburgh Corning Corporation has no control over installation workmanship, accessory materials or conditions of application, **NO EXPRESS OR IMPLIED WARRANTY OF ANY KIND, INCLUDING THOSE OF MERCHANTABILITY OR FITNESS FOR A PARTICULAR PURPOSE, IS MADE** as to the performance of an *installation* containing Pittsburgh Corning products. In no event shall Pittsburgh Corning be liable for any damages arising because of product failure, whether incidental, special, consequential or punitive, regardless of the theory of liability upon which any such damages are claimed. Pittsburgh Corning Corporation provides written warranties for many of its products, and such warranties take precedence over the statements contained herein.

FOAMGLAS®, PITTSEAL®, PITTCOTE®, PITTWRAP®, and PC® are federally registered trademarks owned by Pittsburgh Corning Corporation